

Date: Tuesday, 17/06/2008 10:01:20 AM  
 User: Julie Lecocq

## Process Sheet

<b>Customer</b> :	CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b> :	206L AFT X-TUBE
<b>Job Number</b> :	39902		
<b>Estimate Number</b> :	13222		
<b>P.O. Number</b> :		<b>Part Number</b> :	D206667203TRN
<b>This Issue</b> :	17/06/2008	<b>S.O. No.</b> :	
<b>Prsht Rev.</b> :	NC	<b>Drawing Number</b> :	D206-667-243 REVB
<b>First Issue</b> :	1/1	<b>Project Number</b> :	N/A
<b>Previous Run</b> :	39901	<b>Drawing Revision</b> :	B
<b>Written By</b> :		<b>Material</b> :	
<b>Checked &amp; Approved By</b> :	JUL 08.06.07	<b>Due Date</b> :	30/06/2008
<b>Comment</b> :	Est Rev:A 08-03-06 new issue DD verified by:ec Est Rev B 08.04.02 Removed polish EC verified by: DD		

Qty: 1 Um: Each

## Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0	D6004115	Crosstube Material
-----	----------	--------------------



**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6004-115 Crosstube B34605

Check OD = 2.500"; ID = 1.800"

Q.m 08.06.2007

2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



**Comment:** MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand &amp; install plugs DT8534 on both ends as per Folio FA089

2-Turn first side as per Folio FA089

3-File down transition lines smooth.

Q.m 08.06.2007

3.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------



**Comment:** INSPECT ALL DIM TO DIM SHEET

Q.m 08.06.2007

4.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



**Comment:** MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA089

2-File down transition lines smooth.

3-Remove sand and plugs

Q.m 08.06.2007

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Tuesday, 17/06/2008 10:01:20 AM  
User: Julie Lecocq

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L AFT X-TUBE

Job Number: 39902

Part Number: D206667203TRN

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

A.M 08.06.2011

6.0

QC8

SECOND CHECK



Comment: SECOND CHECK

AWM 8-6-23

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

AWM 8-6-23

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 8-6-23

9.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock in kanban rack

Location: X-TUBE CELL

AWM 8-6-23

10.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/06/26

Job Completion



C208/06/25

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b> 39902
<b>Description:</b> Crosstube Assembly		<b>Part Number:</b> D206-667-243
<b>Inspection Dwg:</b> D206-667-243 <b>Rev:</b> B		<b>Page 1 of 1</b>

### FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.492	✓			
	2.018	+0.005/-0.000	2.023	✓			
	2.079	+0.005/-0.000	2.084	✓			
	2.145	+0.005/-0.000	2.150				
	2.209	+0.005/-0.000	2.214	✓			
	2.287	+0.005/-0.000	2.291	✓			
	2.363	+0.005/-0.000	2.366	✓			
	2.433	+0.005/-0.000	2.433	✓			
	0.200	+/-0.010	0.210	✓			
	0.500 x 30°	+/-0.010	0.500x30°	✓			
	R0.063	+/-0.010	R0.063	✓			
	R0.500	+/-0.010	R0.500	✓			
	4.438	+/-0.030	4.438	✓			
SIDE B	104.91	+/-0.020	104.910	✓			
	2.490	+0.005/-0.000	2.492	✓			
	2.018	+0.005/-0.000	2.023	✓			
	2.079	+0.005/-0.000	2.084	✓			
	2.145	+0.005/-0.000	2.150	✓			
	2.209	+0.005/-0.000	2.214	✓			
	2.287	+0.005/-0.000	2.287	✓			
	2.363	+0.005/-0.000	2.363	✓			
	2.433	+0.005/-0.000	2.433	✓			
	0.200	+/-0.010	0.210	✓			
	0.500 x 30°	+/-0.010	0.500x30°	✓			
	R0.063	+/-0.010	R0.063	✓			
	R0.500	+/-0.010	R0.500	✓			
	4.438	+/-0.030	4.438	✓			

<b>Measured by:</b> a.m	<b>Audited by:</b> ALM	<b>Prototype Approval:</b>	N/A
<b>Date:</b> 08.06.20	<b>Date:</b> 8-6-23	<b>Date:</b>	N/A

Rev	Date	Change	Revised by	Approved
A	06.09.01	New Issue (P/O D206-667-203)	KJ/JLM	

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**DART**

DESIGN PH	DRAWN BY PH	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED # DS	APPROVED # DS	DRAWING NO. D206-667-243	REV. B SHEET 1 OF 3
DATE 05.07.26		TITLE CROSSTUBE ASS'Y (206L HIGH AFT)	SCALE NTS
A	00.11.17	NEW ISSUE	
B	05.07.26	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	

RELEASED  
05-07-26**UNDER REVIEW**  
06.08.18 RH  
re-work details F  
PH 06.06.17

Qty	Part Number	Description
X	D206-667-243	CROSSTUBE ASSEMBLY
1	D6004-115	CROSSTUBE
2	D2856-400-773	ABRASION STRIP
2	D2873-043	NUT PLATE
2	D2873-045	NUT PLATE
2	D2892-1	SUPPORT
14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
4	MS21920-22	CLAMP

**GENERAL NOTES:**

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6004-115  
FINISHED LENGTH = 104.91±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D2892-1 SUPPORT, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) IT IS OPTIONAL TO SEAL EDGES OF SUPPORTS AND ABRASION STRIP USING SIKAFLEX-241/291 SEALANT.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 39902

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector



Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



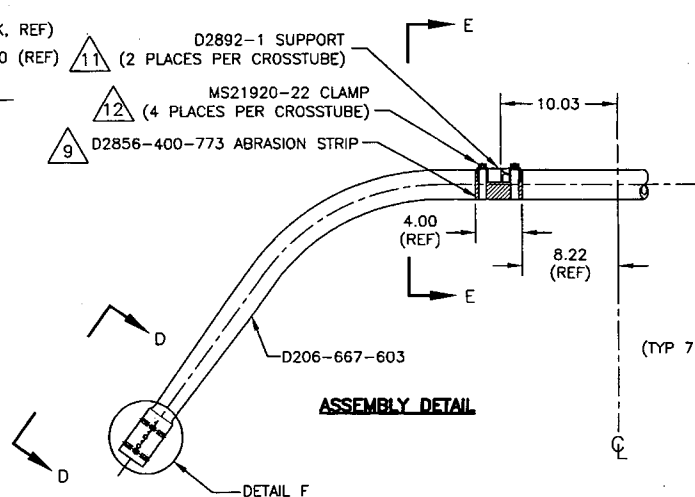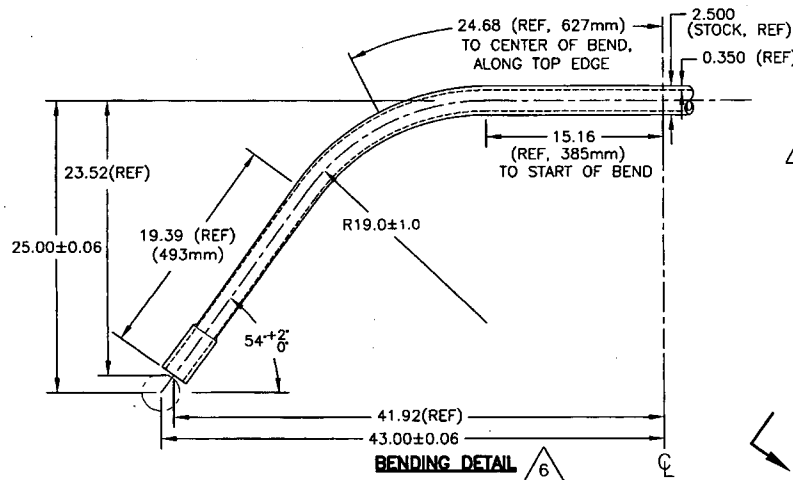

△ B  $\emptyset 0.323^{+0.005}_{-0.000}$   
(TYP 5 PLACES PER CUFF)  
HOLE TO BE ALIGNED WITHIN  $\pm 0.001$   
OF HOLE ON OTHER SIDE OF CUFF




PILOT  $\emptyset 0.128$   
C'SINK  $\emptyset 0.225 \times 100'$   
(TYP 7 PLACES PER CUFF)

FWD SIDE ONLY

**DETAIL F**  
SCALE 2:5

**UNDER REVIEW**  
06.08.10 PH  
re-draw detail F  
06.06.12

**TURNING DETAIL**  
SCALE 1:5

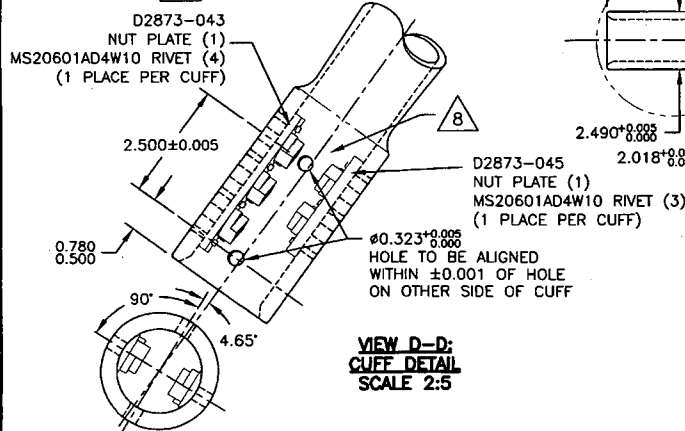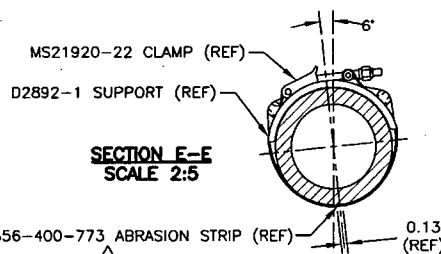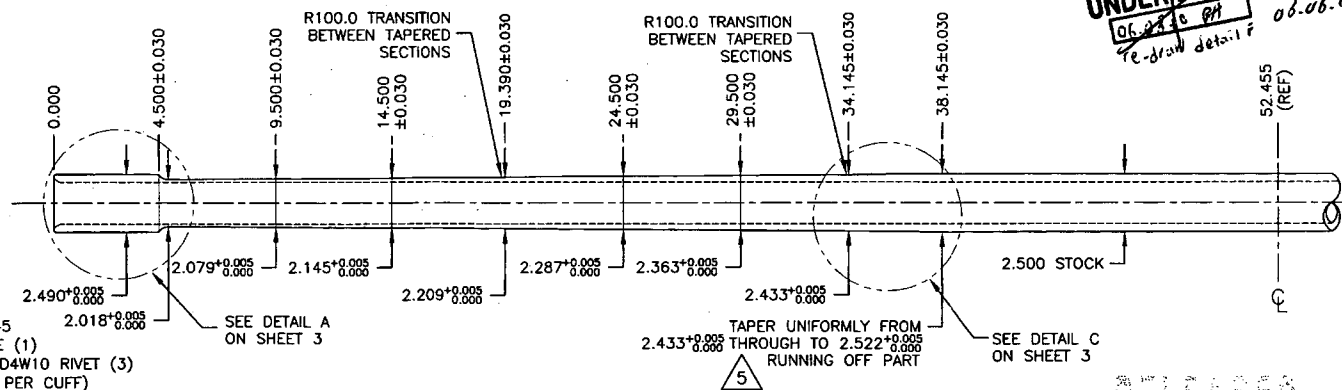

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO 37902

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE LTD.

DESIGN	PH	DRAWN BY	PH	<b>DART</b>	DART AEROSPACE LTD. HAMMERSBURY, ONTARIO, CANADA
CHECKED	DS	APPROVED	DS	DRAWING NO.	D206-667-243
DATE	05.07.26	TITLE	CROSSTUBE ASS'Y (206L HIGH AFT)	REV. B	SHEET 2 OF 3
				SCALE	1:10

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# DETAIL A: CROSSTUBE CUFF

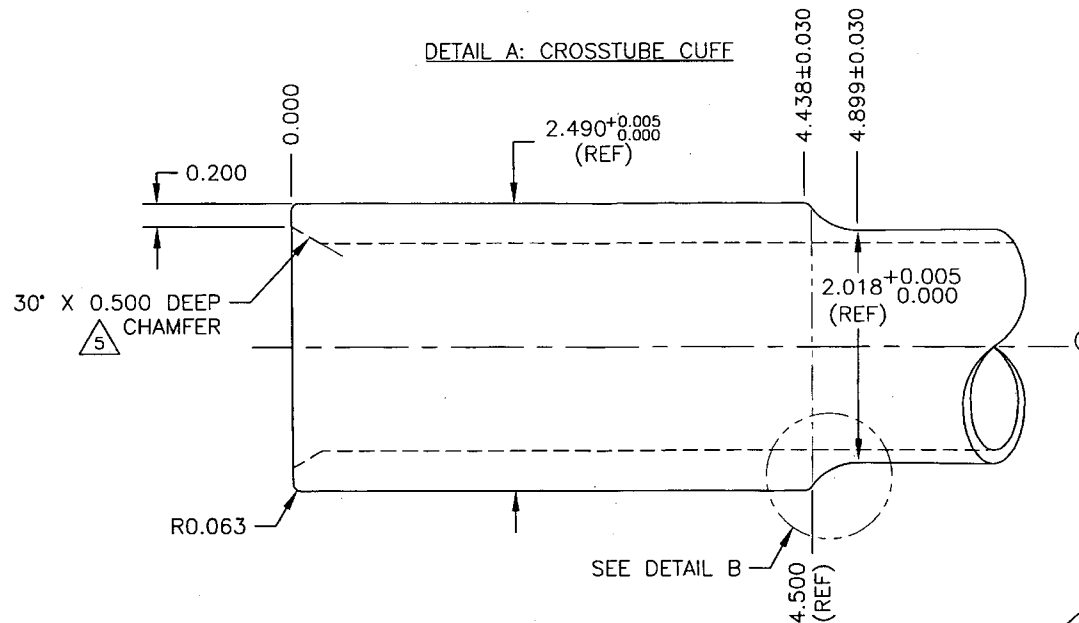


UNDER REVIEW  
06.03.10 PH  
re-drawn detail r  
ref 01.06.17

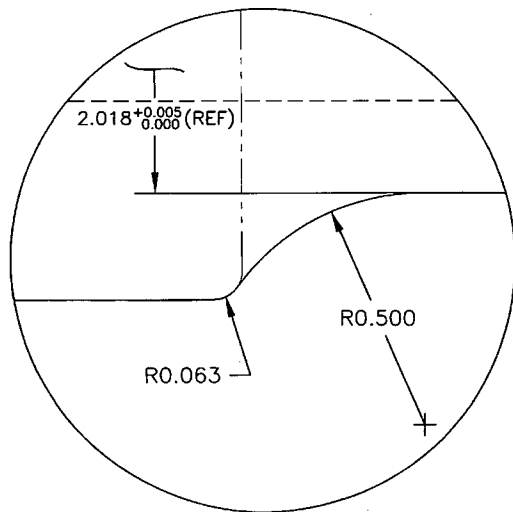

DETAIL B: CUFF  
TRANSITION  
SCALE 4:1

DETAIL C:  
TAPER RUN-OFF  
NOT TO SCALE

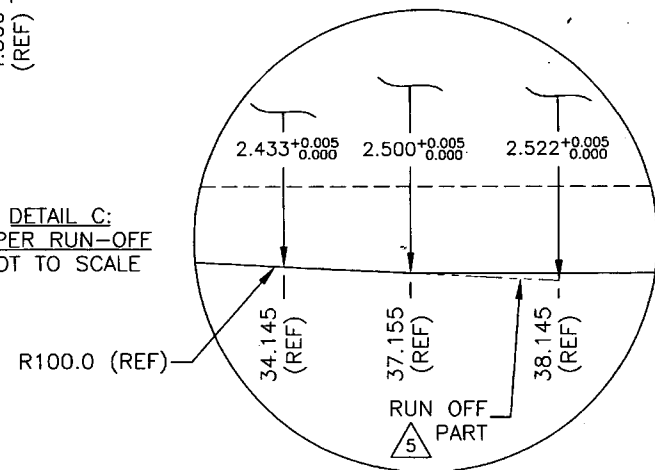

NO. 34902  
WORK ORDER  
WITHOUT NOTICE  
SUBJECT TO AMENDMENT  
UNCONTROLLED COPY  
ENGINEERING  
RETURN TO  
SHOP COPY

COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	<b>DART</b> DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		PH	PH	DRAWING NO.	REV. B
		CHECKED #DS	APPROVED #DS	D206-667-243	SHEET 3 OF 3
		DATE		TITLE	SCALE
		05.07.26		CROSSTUBE ASS'Y (206L HIGH AFT)	1:1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries